

Midmark Electric Lift Table Manual



Table of Contents

Pre-Installation	2
Parts Identification	2
Installation	3
Installation with Scale Option	4
Scale Features/Operation	4
Troubleshooting	5
Care & Cleaning	6
Specifications	6
Product Warranty	7
Product Satisfaction Policy	7

Pre-Installation



WARNING

Do not move surgery table by yourself. Improper handling may result in injury or damage to the product.



WARNING

Never Place foot on the table's base or under the table top.


Note

Save all packaging until certain you are satisfied with the product.

Open packages carefully. Inspect the shipping carton and contents for any visible damage.

The Electric Lift Exam Table is fully assembled and contained within one carton on a pallet. If ordered with optional built-in scale, the scale display and cords are contained within a smaller box within the carton on pallet. The display will need to be mounted onto the Electric Lift Exam Table. See installation instructions.

Parts Identification

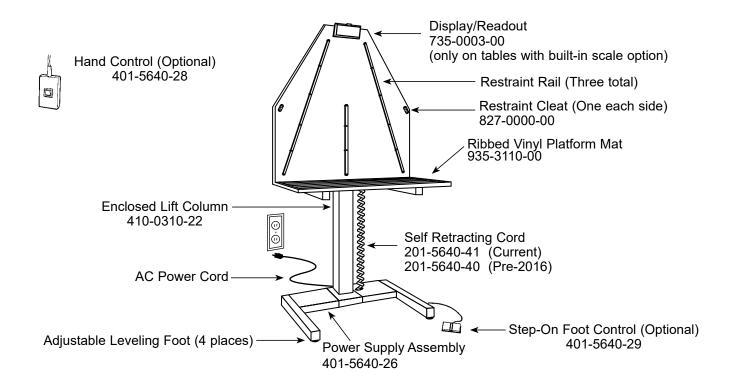

No. 101-5640-01 Electric Lift Exam Table with Hand Control No. 101-5640-07 Electric Lift Exam Table with Foot Control


No. 110-3210-00 Electric Lift Exam Table with Scale with Hand Control No. 110-3210-01 Electric Lift Exam Table with Scale with Foot Control

2


Parts Identification continued

Restraint Options

Animals can be restrained on the Electric Lift Exam Table using one of these three methods:



1. Make a loop with the leash and thread it behind the restraint rail. Bring the end of the leash through the loop and pull both ends of the leash to tighten.



2. Thread leash behind restraint rail and through restraint cleat.



3. Bring leash around the back of the table and secure to figure eight tie-down.

Installation

After removing the table from its packaging, the table is ready to be placed in the desired position within your facility. The table is very heavy, so we recommend using a four-wheeled furniture cart to make moving easier. If a cart is not available we suggest having four strong people to lift and move the table.

Stand upright by grasping top center of column

DO NOT use the restraint cleat rails as handles!

DO NOT lift by stainless steel exam top!

Stand by grasping top center of column

Of the Do NO cleat rails as handles!

To Lift the Electric Lift Exam Table:

When moving the electric lift exam table, NEVER lift the table by the stainless steel top! Lower the table top to its lowest position. This will be the position the table has arrived in.

Stand the table upright by grasping the lift column at the top center of the exam top back. Do NOT use the restraint cleat rails or stainless steel top as handles!

Lift table by grasping base

Lift table by


grasping base

Friction Strip

610-0177-00


Installation with Scale

Refer below for connecting instructions if installing a lift table with the optional scale built-in.

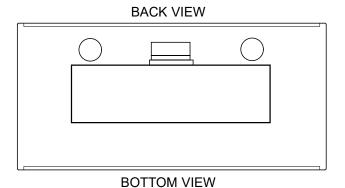

- Remove the scale/readout display from the small box enclosed within the carton on the pallet.
- Hang the scale readout/display over the top back of the stainless steel exam top.





Scale Features/Operation


Key Functions

ON/OFF:

1. Press and release **ON/OFF** key to turn scale On or Off.

UNIT:

 Press the **UNIT** key to change the weighing units to the alternate units of measurement.

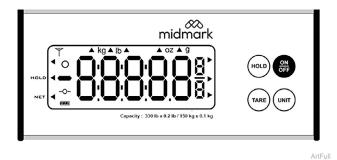

TARE:

- 1. Press the **TARE** key to zero the weight display or to tare the weight of a container (e.g. box or crate).
- 2. Press and hold the **TARE** key to enter the Configuration mode.

HOLD:

- Press to turn the **HOLD** function On or Off.
- 2. Press to toggle between the settings for each configuration parameter, and then advance to the menu.



DO NOT operate the keypad with pointed objects (pencils, pens, etc).

Damage to keypad resulting from this practice is NOT covered under warranty.

Troubleshooting

Display Annunciators:

The display annunciators are turned on to indicate that the scale display is in the mode corresponding to the annunciator label or that the status indicated by the label is active.

0

This is turned on when the weight display is stable.

This is turned on when a negative (minus) weight is displayed.

→0**←**

This is turned on when the scale weight has been zeroed.

HOLD 4

This is turned on after pressing the **Hold** key.

NET ◀

This is turned on after pressing TARE key to tare weight of item on scale.

kg

This is turned on to indicate that the display weight is in kilograms.

lb

This is turned on to indicate that the display weight is in pounds.

In the event that a problem occurs, a Midmark technician is ready to assist you. Call Midmark for assistance before attempting any repairs.

In The Event Of A Problem:

In the event that a problem occurs, Midmark Technical Support is ready to assist you. In order to save time, please check the following items before calling:

- Does the readout display have a message that indicates what the problem is? Refer to "Indicators" at left for descriptions.
- Check all cables/connections.

Midmark Technical Support: 1-800-643-6275

Care & Cleaning

The Electric Lift Exam Table may be cleaned with any commercially available product recommended for use on stainless steel. Frequent cleaning will prolong the life and help maintain the natural luster of the stainless steel.

To prevent scratching, use a soft cloth to clean the stainless steel exam surface. If scrubbing is necessary, use a nylon or plastic type scrubber. When cleaning, always rub in the direction of the "grain" of the metal.

To remove minor scratches, we recommend using a 3M ScotchBrite[®] scouring pad rubbed lightly in the direction of the "grain" of the metal.

Never use steel wool or steel brushes when cleaning stainless steel. Steel particles may become embedded into the stainless steel and cause rust.

Avoid use of chlorine bleach for cleaning. Chlorides, bromides, iodides and thiocyanates will cause pitting, corrosion and discoloration of the metal. If using bleach, clean thoroughly with water to completely remove bleach residue.

Avoid excessive moisture.

The Electric Lift Exam Table contains electronic components that may be damaged by excessive exposure to moisture. When cleaning the table or mopping the floor around the table, do not use excessive water or leave the table in standing water.

Specifications

Exam Surface Dimensions: 44" x 22"

Height adjusts 7" to 38 1/2"

Overall Dimensions: 44" x 31"

Max height 84 1/2" when raised

Lift Capacity: 225 pounds

Scale Capacity (optional): 300 pounds

Scale Accuracy: Within 0.2% at 300 pounds

Electrical: Operates on standard 110 VAC



Caution

Never attempt to exceed the lift capacity of 225 pounds.

Product Warranty

This product is warrantied for 1 year from the date of delivery to the original purchaser only. If equipped with the built-in Midmark Scale, the scale is warranted for 1 year. The warranty is only applicable if customer complies with all instructions and specifications furnished by Midmark relating to installation, care, and application. The customer agrees not to modify, misapply, or misuse product in any manner which deviates from the Midmark instructions. Any repairs, alterations, or services provided by parties other than Midmark or its authorized representatives may void warranty. The buyer is responsible for all freight charges on returned items.

Product Satisfaction Policy

In the event that the customer is not fully satisfied with the products purchased, Midmark may, at its own discretion, arrange for the customer's account to be credited (excluding shipping charges) or replace the product. The customer must notify Midmark of any claim of nonconformity or defect in writing within 30 days from the date of receipt. The product must be returned to Midmark in its original packaging, undamaged and showing no unusual wear within 20 days of the customer's written notice.

To return an item, follow these simple instructions:

- Call Midmark for complete instructions (800-643-6275)
- A sales representative will give you a Return Authorization Number
- If a Restocking Fee applies, you will be informed at this time
- Label the boxes with the Return Authorization Number (All items must have a Return Authorization Number)
- Return the items, postage/freight prepaid

If necessary, the Midmark sales representative will assist you with freight arrangements.

Note: Custom orders and/or custom colors may not be returned.

Midmark Corporation - Carthage Facilities

1000 Civil War Road Area 5 Carthage, MO 64836 1-800-643-6275

